FMEA NO. 6.0.7

Loss of syac/command stomal to

Component Board Assembly, Al,

wrist tameras.

2293218-501

Cause:

## SMITTLE CCTV CRITICAL ITEMS LIST

		Video S 33–501	witch IRVS)
SHEET	二	_ OF	6

CRITICALITY 2/2 FAILURE EFFECT FAILURE HODE AND CAUSE

ON END ITEM

loss of synchronization and command and control capability of wrist camera and line assembly.

Worst Case: Iris would not open: na videa for mission critical function.

RATIONALE FOR ACCEPTANCE DESLEN FEATURE

BARE BOARD DESIGN (A1)

The design of the associated Al board is contructed from laminated copper-clad epoxy glass sheets (NEHA 6-10) Grade FR-4), PER MIL-P-55617A. Circuit connections are made through printed traces which run from point to point on the board surfaces. Every trace terminates at am annular ring. The annular ring surrounds the hole in which a component lead or terminal is located. This ring provides a footing for the solder, ensuring good mechanical and electrical performance. Its size and shape are governed by MIL-P-SS640 as are trace widths, spacing and routing. These requirements are reiterated specifically in drawing notes to further assure compliance. Variations between the artwork master and the final product (due to irregularities of the etching process) are also controlled by drawing notes. This prevents making defective boards from good artwork. Holes which house no lead or terminal, but serve only to electrically interconnect the different board layers, contain stitch bars for mechanical support and increased reliability.

The thru koles are drilled from a drill tape thus eliminating the possibility of human error and allowing tight control over hole and annular ring concentricity, an Important reliability criterion. After drilling and etching, all copper cladding is tim-lead plated per MIL-STD-1495. This provides for easy and reliable soldering at the time of board assembly, even after periods of prolonged storage.

## BOARD ASSEMBLY DESIGN (A1)

All components are installed in a manner which assures maximum reliability. Component leads are pre-tinned, allowing total wetting of solder joints. All leads are formed to provide stress relief and the bodies of large components are staked. Special mounting and handling instructions are included in each drawing requires after final assembly. The board is coated with urethane which protects against humidity and contamination.

## BDARD PLACEMENT

The Al board is secured in the electronics assembly by gold-plated heryllium copper card guides. Connections are made to the mother board with blind-mated connectors. Disengagement during launch is prevented by a cover which spans the board's free edge.

6-38

FREA NO. <u>6.0.7</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV	DMG NO. 2293633-501			
		CRITICAL ITEMS LEST	SHEET 2 OF 6			
FAILURE MODE AND CAUSE	FATLURE EFFECT ON END ITEM	RATIONALE FOR ACCEPTANCE				
coss of sync/command signal to crist camera.  Cause: Component Board Assembly, A), 2293218-501	Loss of synchromization command and control capability of wrist camero and line assembly.  Horst Case: Iris would not open; no video for mission critical function.	For Qualification Test flow, see Table 2 located at ACCEPIANCE YESI  The CCTV system's RVS is subjected directly, without might be used in normal installation, to the follow a Vibration:  20-80 Hz: 358-750 Hz: 368-750 Hz: 358-750 Hz: 368-750 Hz: 358-750 Hz: 368-750 Hz: 358-750 Hz: 368-750 Hz:	t vibration isolators which ing testing:  rom 0.01 G <sup>2</sup> /Hz  pe  s  e front of this book.  onal, a test must verify the he PHS (A7A1) panel switch, ra/PHJ, to the Camera/PTU command lity to preduce video, the VSU's o display video. A similar test that if video on monitor is is indicates that the camera and that the camera is producing a commands and visually (either ify operation. under test as source.  nel. ands via the MDM command path.			

UNIT Regate Video Switch (RVS) она ма. 2293633-501. SHUTTLE CCTV FHEA NO. 6.0.J CRETICAL ETERS LIST CRETICALLITY 2/2 FAILURE EFFECT FATLURE MODE AND RATIONALE FOR ACCEPIANCE ON END ITEM CAUSE OA/INSPECTION Loss of swichronization loss of sync/command signal to and command and control wrist camera. <u>Procurement Control</u> - The RVS EEF Parts and hardware items are procured from approved capability of wrist vandors and suppliers, which most the requirements set forth in the CCTV contract and camera and line assembly. Cause: Quality Plan Work Statement (WS-2593176). Resident DCAS personnel review all Component Bhard Assembly, Al. procurement documents to establish the need for GSI on selected parts (PAI 517). 2293218-501 Worst Case: Iris would not open; Incoming Inspection and Storage - Incoming Quality inspections are made on all no video for mission received materials and parts. Results are recorded by lot and retained in file by critical function. drawing and control numbers for future reference and traceability. All EEE parts are subjected to incoming acceptance tests as called for in PAI 315 - Incoming Inspection lest Instructions. Incoming flight parts are further processed in accordance with RCA 1846684 - Preconditioning and Acceptance Requirements for Electronic Parts, with the exception the DPA and PING testing is not performed. Hechanical items are inspected per PAI 316 - Incoming Inspection Instruction for mechanical Items, PAI 305 - lacoming Quality Control Inspection Instruction, and PAI 612 - Procedure for Processing Incoming or Purchased Parts Designated for Flight Use. Accepted items are deliveredto Material Controlled Stores and retained under specified conditions until cable fabrication is required. Non-conforming materials are held for Material Review Board (NRB) disposition. (PAI-307, PAI 10C-531.) Board Assembly & Test - Prior to the start of RVS board assembly, all items are verified to be correct by stock room personnel, as the items are accumulated to form a kit. The items are verified again by the operator who assembles the kit by checking against the as-built-parts-list (ABPL). DCAS Handatory Inspection Points are designated for all printed circuit, wire wrap and welded wire boards, plus harness connectors for soldering wiring, crimping, solder splices and quality worknamship erior to coating of the component side of boards and sleeving of harnesses. Specific RYS board assembly and test instructions are provided in drawing notes, and applicable decuments are called out in the Fabrication Procedure and Record (FPR-2293633) and parts list PL 2293633. These include wire connection List 2295955. Process Standard RTV-566 2280881, Process Standard - Booding elero Tape 2200889. Specification Soldering 2280749, Specification Name Plate Application 1960167, Specification - Crimping 2280800, Specification - Bunding and Staking 2280878, Specification - Urethane coating 2280877, Specification - locking compound 2026116, Specification Exposy Adhesive 2010905. Specification - Marking 2200676. Specification - Northwayship 8030035. Specification Bonding and Staking 228075.

ţ

FREA NO. 6.0.7 CRITICALITY 2/2		SHUTTLE CCTV CRITICAL 1TEMS LIST	UNIT Remote Video Switch (RVS) OMG NO. 2293633-501
		·	SHEET 4 OF 6.
FAILURE MODE AND CAUSE Loss of sync/command signal to wrist camera.  Cause: Component Board Assembly, Al, 2293218-501	FAILURE EFFECT ON END 17EM  Loss of synchronization and command and control capability of wrist camera and line assembly.  Morst Case: Iris would not open; no video for mission critical function.	QA/INSPECTION (Continued)  RYS Assembly and lest  Acceptance Tests are performed per IP-AI-2293633, are specified and witnessed, traceability numbers checked prior to use. RCA Quality and BCAS inspectant of specified FPR operations in acceptance and PAI-217. DCAS personnel witness RYS button-u OCAS personnel monitor acceptance tests and review also inspect after all repair, rework and retest.  Preparation for Shipment - The RVS is packaged acceptance of Grandled for Packaging and Handling guidelines. assembly drawings, Parts List, ABPL, Test Data, educumentation folder assigned specifically to enciretained for reference. An EIDP is prepared for requirements of MS-2593176. RCA QC and DCAS personacting and marking, and review the EIDP for comp	including thermal vacuum. Torques are recorded and calibrated tools are chians are performed at the new with PAI-204, PAI-205, PAI-206 and critical torquing. RCA and test data/results. These personnel cording to 2280746, Process with related documentation including to, is gathered and held in a casembly. This folder is each RVS in accordance with the kinel witness crating, packaging,

FMEA NO. <u>6.0.7</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRITICAL LIENS LIST		DMET Remote Video Switch (RVS) DWG ND. 2293633-501			
		CRITI	· CRITICAL LIENS LIST		<u> </u>	F <u>6</u>	
FAILURE MODE AND FAILURE EFFECT		RATIONALE FOR ACCEPTANCE					
CAUSE Loss of sync/command signal to wrist camera. Cause: Component Board Assembly, Al, 2293218-501	Loss of synchronization and command and control capability of wrist camera and line assembly.  Worst Case: Iris would not open: An video for mission critical function.	FAILURE HISTORY MONE					.'
	critical function.						
•							
	-						
				•			
	1	F .					

FHEA NO. <u>6.0.7</u> CRITICALITY <u>2/2</u>		SHUTTLE CCTV CRETICAL ITEMS EIST	UNIT Remote Video Smitch (RVS) ONG NO. 2293633-501 SHEET 6 OF 6	
TAILURE MODE AND CAUSE Loss of sync/command rignal to wrist camera.  Cause: Component Anard Assembly, A1, 2293210-501	faithme effect OH END ITEN Loss of synchronization and command and control capability of wrist camera and line assembly.  Morst Case: Iris would not open; no video for mission critical function.	PERATIONAL EFFECIS  Loss of video. Possible loss of major mission objective CREW ACTIONS  If possible, continue RMS operations using alternative of CREW IRAINING Crew should be trained to use possible alternatives to MISSION CONSTRAINI  Where possible, procedures should be designed so they acced to the continue of the continue RMS operations using alternative of CREW IRAINING C	visual cues.	
	- T			